

Fig. 1



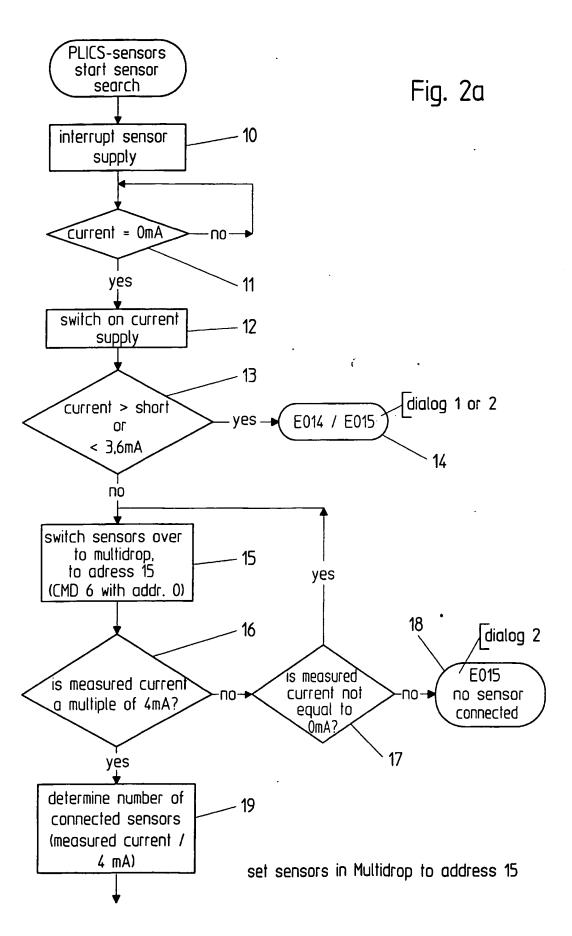


Fig. 2b

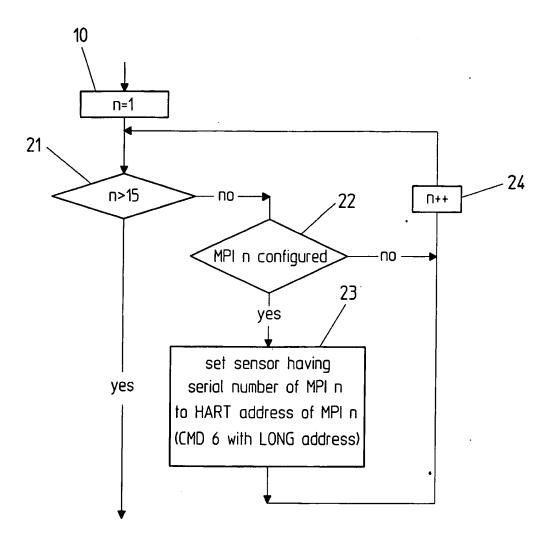

address configured sensors

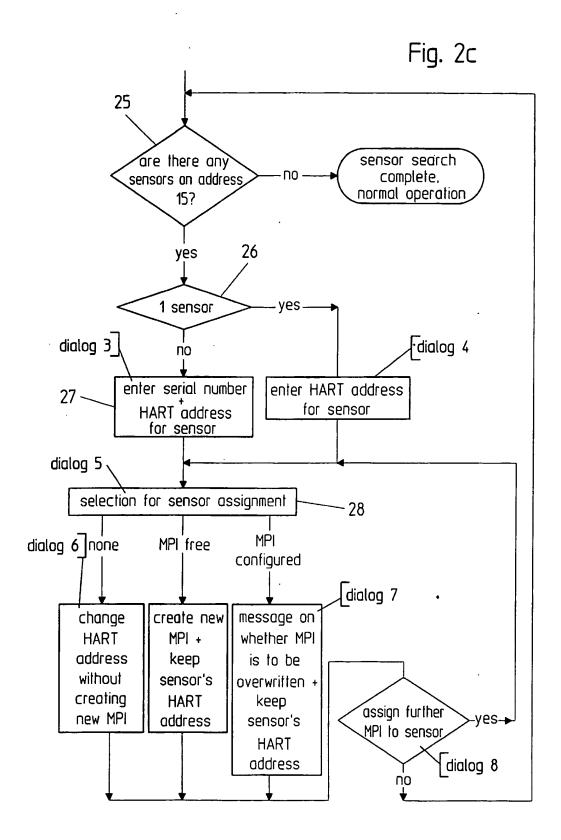

address free sensors and assign MPI

Fig. 3

Error

power interruption or no sensor connected

E015

Fig. 4

Error

short circuit

E014

Fig. 5

sensor addressing

serial No.: 12345678

HART-address: 15

Fig. 6

sensor address

0

Fig. 7

sensor association

MPI1 (configured)

•

list selection:

MPI1 (configured / free) MPI2 (configured / free) none

Fig. 8

sensor addressing

serial number: 12345678

HART-address: 15

7/7

Fig. 9

sensor association

should existing MPI be overwritten?

Fig. 10

sensor association

assign further MPI to sensor?